


TIBURON(RC) >1999 > G 2.0 DOHC > Fuel System > Fuel Delivery System > FUEL FILTER REPLACEMENT

FUEL FILTER REPLACEMENT

1. Reduce the internal pressure of the fuel pipes and hoses by completing the following operations.
 - (1) Disconnect the fuel pump harness after removing the rear seat cushion.
 - (2) Start the engine and after it stalls, turn the ignition switch OFF.
 - (3) Disconnect the battery negative (-) terminal.

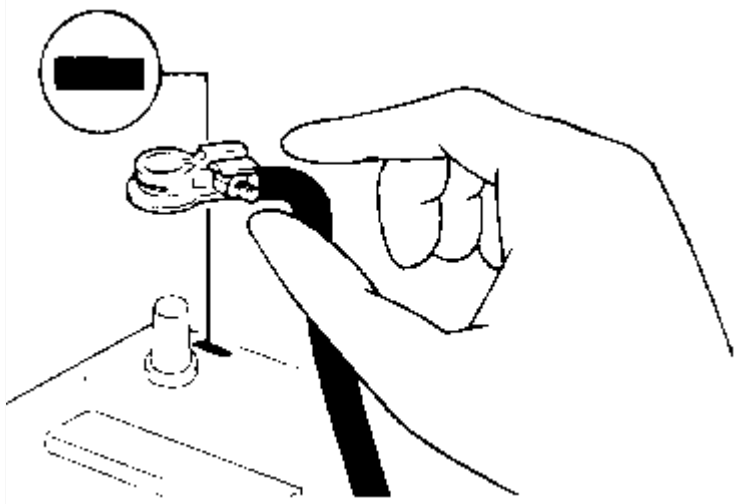

- (4) Connect the fuel pump harness connector.
2. Remove the bolt connecting the fuel line with the fuel filter.
Cover with a shop towel to avoid gasoline from splashing.
3. Remove the fuel filter mounting bolt, then remove the fuel filter from the fuel filter clamp.
4. After replacing the fuel filter, check for fuel leaks.

